
991 Thrust Transmitter

Bently Nevada* Asset Condition Monitoring

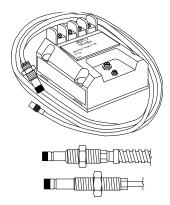

Description

The 991 Thrust Transmitter is intended primarily for the original equipment manufacturers (OEMs) of centrifugal air compressors or small pumps, motors, or fans who prefer to provide a simple 4 to 20 mA proportional axial displacement (thrust) signal as the input to their machinery control system. The transmitter is a 2-wire, loop-powered device that accepts input from our 3300 NSv* proximity probe and its matching extension cable (available in 5 m and 7 m system length options). The transmitter conditions the signal into appropriate engineering units proportional to the shaft's axial position¹, and provides it as a 4 to 20 mA industry-standard signal for input to the control system where machinery protection alarming and logic occurs².

The 991 transmitter provides the following notable features:

- Integrated Proximitor* Sensor requires no external unit
- Non-isolated "PROX OUT" and "COM" terminals plus a coaxial connector provide a dynamic vibration and gap voltage signal output for diagnostics³.
- Non-interacting zero and span potentiometers under the Transmitter label supports loop adjustment.
- Test Input pin allows quick verification of loop signal output, using a variable DC voltage source as the input.
- A Power-up Inhibit circuit eliminates signal errors due to line voltage
- A Not OK/Signal Defeat circuit prevents high outputs or false alarms due to a faulty proximity probe or loose connection.
- Choice of DIN-rail clips or bulkhead mounting screws as standard options simplifies mounting.
- Potted construction for high humidity (up to 100% condensing) environments.
- Compatibility with 3300 NSv proximity probe allows transducer installation in small areas with minimal clearance, typical of centrifugal air compressors.

Notes:

- Probe adjustment and range are critical in thrust position measurements. Incorrect probe aap settings may prevent the transmitter from reaching full-scale in either the normal or counter directions (no machinery monitoring). For proper adjustment, follow the instructions in the manual.
- Thrust transmitters have many limitations when compared to a continuous monitoring system. They are a practical solution in some applications for measuring rotor axial position and are a valuable tool for trending thrust readings. While the transmitter is capable of alarming on thrust position and non-OK checking, monitor functions such as Timed OK channel defeat, Danger Bypass, and Trip Multiply cannot be used. In addition, PLCs attached to the thrust transmitter are not suitable for plant-wide diagnostic systems such as System 1 or Rule Paks.
- The 991 Vibration Transmitter's "Prox Out" coaxial connector provides a non-isolated dynamic transducer signal for machinery diagnostics. You can connect this signal directly to battery-powered or isolated test equipment to diagnose machinery problems. However, since the "PROX OUT" signal is not isolated from the 4 to 20 mA loop signal, an interface is available (and strongly recommended) for signal isolation. The 990/991 Test Adapter conditions the 990 Transmitter's "PROX OUT" signal for use with ac-powered test equipment.









The adapter also inverts and isolates the 990's transducer signal, making it suitable for equipment such as oscilloscopes and analyzers, and preserving industry-standard conventions for signal polarity. We strongly recommend that you use this test adapter for all applications to maintain isolation between test equipment and the loop signal, and to maintain machinery protection integrity.

Specifications

Unless otherwise noted, the following specifications apply at +22 °C (+72 °F) using a 3300 NSv Probe and Extension Cable, and an AISI 4140 steel target.

Electrical

Input

Accepts 1 non-contacting 3300 NSv Proximity Probe and extension cable.

Power

Requires +12 to +35 Vdc input at the transmitter terminal.

4 to 20 mA Signal Output

4 to 20 mAdc over specified full-scale range in 2-wire configuration.

4 to 20 mA Loop Accuracy

Within $\pm 1.5\%$ over specified full scale range (typical). Accuracy is rated from the TEST signal input to the voltage measured across a 250 Ω loop resistance.

Maximum Loop Resistance

1,000 Ω including cable at 35 Vdc.

Current Limiting

23 mA typical.

Zero and Span

Non-interacting external adjustments.

Not OK/Signal Defeat

Signal output will go to less than 3.6 mA within 100 µs after a Not OK condition occurs. Signal output is restored within 0.1 seconds after the Not OK condition is removed.

Proximitor Sensor Output

Compatible with ungrounded, portable test equipment. When using grounded, ac-powered test equipment, use the 122115-01 Test Adapter for signal isolation.

Output Impedance

Prox Out has a 10 k Ω output impedance calibrated for a 10 M Ω load.

Linear Range

0.25 to 1.65 mm (10 to 65 mils) for Prox Out. Suitable for 0.6-0-0.6 mm or 25-0-25 mils current loop linear ranges.

Prox Out Incremental Scale Factor

7.87 mV/ μ m (200 mV/mil) \pm 6.5% typical including interchangeability errors when measured in increments of 0.25 mm (10 mils) over the linear range using a flat 30 mm (1.2 inch) target.

Temperature Stability

Incremental scale factor remains within $\pm 10\%$ of 7.87 mV/ μ m (200 mV/mil) from 0 °C to ± 70 °C (± 32 °F to ± 158 °F).

Minimum target size

9.5 mm (0.375 in) diameter.

Leadwire Length

Proximitor* Sensor Output (BNC connector), maximum cable distance is 3 metres (10 feet).

Non-Hazardous, Zone 2 or Div 2 Hazardous area locations

13 km (8 miles) maximum between transmitter and receiving device for signal output.

Intrinsically Safe Hazardous area locations

68 metres (225 ft.) maximum between transmitter and receiving device for signal output.

Electrical Classification

General Purpose Approval by Canadian Standards Association (CSA/NRTL/C) in North America and by VDE in Europe. The 991 has the CE mark for Europe.

Hazardous Area Approvals
CSA/NRTL/C

Class I, Div 2 Groups A, B, C, D T5 @ Ta \leq 85 °C, Type 4 Per Drawing 128838

ATEX

Ex ia IIC T4 Ga

T4 @ -35° C \leq Ta \leq $+85^{\circ}$ C

⟨Ex⟩ II 3 G
Ex nA IIC T4 Gc

T4 @ -35°C ≤ Ta ≤ +85°C

KTL/KC

Ex ia IIC T4 Ga
 T4 @ -20°C ≤ Ta ≤ +100°C

IECE×

Ex ia IIC T4 Ga

T4 @ -35°C ≤ Ta ≤ +85°C

Ex nA IIC T4 Gc

T4 @ -35°C ≤ Ta ≤ +85°C

Maritime Approvals

American Bureau of Shipping (ABS) Type Approval

Certification Number

06-HS177078-3-PDA

Environmental Limits

Transmitter Temperature

Operating Temperature

-35 °C to +85 °C (-31 °F to +185 °F)

Storage Temperature

-51 °C to +100 °C (-60 °F to +212 °F).

Probe Temperature

Operating Temperature

-35 °C to +177 °C (-31 °F to +350 °F).

Storage Temperature

-51 °C to +177 °C (-60 °F to +350 °F).

Relative Humidity

100% condensing, non-submerged, with protection of coaxial connectors.

Mechanical Transducer Tip Material

Polyphenylene sulfide (PPS).

Transducer Case Material

AISI 303 or 304 Stainless Steel (SST).

Probe Cable

 75Ω coaxial, fluoroethylene propylene (FEP) insulated.

Cable Armor (optional)

Flexible AISI 302 SST with optional

FEP outer jacket.

Tensile Strength

222 N (50 lbf) probe case to probe

lead, maximum.

Transmitter Weight

0.43 kg (0.9 lbm).

Total System Weight

0.82 kg (1.8 lbm) typical.

Example: 3 5 = 3.5 in **Ordering Information** C: Total Length Option 991-AXX-BXX-CXX-DXX 05 0.5 metre (1.67 feet) 10 1.0 metre (3.25 feet) A: Full-scale Option 50 5.0 metres (16.4 feet) 0.6 -0- 0.6 mm 06 70 7.0 metres (23 feet) 25 25-0-25 mils System Length Option D: Connector Option 5.0 metres (16.4 feet) 50 **01** Miniature coaxial ClickLoc* 7.0 metres (23.0 feet) 70 connector with connector protector, C: **Mounting Option** standard cable 01 35 mm DIN-rail clips **02** Miniature coaxial ClickLoc connector. 02 Bulkhead screws standard cable 03 DIN clips and screws 11 Miniature coaxial ClickLoc connector Agency Approval Option with connector protector, FluidLoc* 00 Not required 01 CSA Division 2 12 Miniature coaxial ClickLoc connector 0.5 CSA Division 2, ATEX Zone 0, ATEX attached, FluidLoc cable Zone 2 and includes ABS maritime E: Agency Approval Option approval 00 Not required 05 Multiple Approvals (CSA NRTL/C and 3300 NSv Proximity Probes BASEEFA/CENELEC, which includes 330901 CSA Division 2) 3300 NSv Probe, 1/4-28 UNF thread, 3300 NSv Probes, Metric without armor. 330903 330902 3300 NSv Probe, M8 x 1 thread, 3300 NSv Probe, 1/4-28 UNF thread, without armor. with armor. 330904 330908 3300 NSv Probe, M8 x 1 thread, with 3300 NSv Probe, 3/8-24 UNF thread, armor. without armor. 330905 330909 3300 NSv Probe, M10 x 1 thread, 3300 NSv Probe, 3/8-24 UNF thread, without armor. with armor. 330910 Part Number-AXX-BXX-CXX-DXX-EXX 3300 NSv Probe, M10 x 1 thread, **Option Descriptions** with armor. A: Unthreaded Length Option Part Number-AXX-BXX-CXX-DXX-EXX Note: Unthreaded length must be at least 0.7 in less than the case length. **Option Descriptions** Order in increments of 0.1 in A: Unthreaded Length Option Length configurations: Note: Unthreaded length must be at least 20 Minimum length: 0 in mm less than the case length. Maximum length: 9.2 in Order in increments of 10 mm **Example: 0 4** = 0.4 in Untreaded length configurations: B: Case Length Option Minimum length: 0 mm Order in increments of 0.1 in Maximum length: 230 mm Threaded length configurations:

Minimum length: 0.8 in Maximum length: 9.9 in

Example: 06 = 60 mm

B: Case Length Option **060** 6.0 metres (19.7 feet) Order in increments of 10 mm **065** 6.5 metres (21.3 feet) Minimum length: 20 mm B: Armor Option Maximum length: 250 mm 00 Without stainless steel armor **Example:** 25 = 250 mm With FEP covered stainless steel 01 C: Total Length Option armor 05 0.5 metre (1.67 feet) 02 With stainless steel armor 1.0 metre (3.25 feet) 10 03 Without stainless steel armor. 50 5.0 metres (16.4 feet) with connector protector 70 7.0 metres (23 feet) 04 With FEP covered stainless steel D: Connector Option armor and connector protector 01 Miniature coaxial ClickLoc connector 05 With stainless steel armor and with connector protector, standard connector protector cable C: Agency Approval Option **02** Miniature coaxial ClickLoc connector. 00 Not required standard cable Multiple Approvals (CSA NRTL/C 05 11 Miniature coaxial ClickLoc connector and BASEEFA/CENELEC (which with connector protector, FluidLoc includes CSA Division 2)

Accessories

122115-01

990/991 Test Adapter. Package includes: 990/991 Test Adapter, 9V battery, Universal ac Adapter, Power Cord (North American), User Guide and Soft Carrying Case.

The 990/991 Test Adapter inverts and isolates the PROX OUT signal from the 991 Transmitter so you can connect 991 Transmitters to acpowered diagnostic equipment. The Adapter modifies the PROX OUT signal so that it matches our Proximitor Sensor signals by performing these functions:

- Shifts the phase of the PROX OUT signal by 180° by changing the voltage from positive to negative
- Isolates the transmitter from diagnostic equipment so that equipment with different grounds will not affect the transmitter's 4-20 mA loop signal
- Reduces noise in the surrounding area from affecting the PROX OUT signal

3300 NSv Reverse Mount Probe

E: Agency Approval Option

330906-02-12-CXX-DXX-EXX, 3/8-24 UNF threads

00

05

330907-05-30-CXX-DXX-EXX. M10 x 1 UNF threads

Option Descriptions

C: Total Length Option

0.5 metre (1.67 feet)
1.0 metre (3.25 feet)
5.0 metres (16.4 feet)
7.0 metres (23 feet)

Not required

D: Connector Option

0 2 Miniature coaxial ClickLoc connector, standard cable

12 Miniature coaxial ClickLoc connector attached. FluidLoc cable

Multiple Approvals (CSA NRTL/C

and BASEEFA/CENELEC, which

includes CSA Division 2)

12 Miniature coaxial ClickLoc connector attached, FluidLoc cable

E: Agency Approval Option

00 Not required

0 5 Multiple Approvals (CSA NRTL/C and BASEEFA/CENELEC, which includes CSA Division 2)

Extension Cable

330930-AXXX-BXX-CXX

A: Cable Length Option

0 4 0 4.0 metres (13.1 feet) **0 4 5** 4.5 metres (14.8 feet)

The 990/991 Test Adapter provides 123655-01 the following benefits: Manual. Small size and weight for 330153-05 Cable Connector Kit. Package portable operation Includes 1 set of 75 Ω miniature male Battery or ac adapter power and female connectors, shrink tubing options and 3300 Isolator Seal for protection of coaxial connectors. Automatic shutoff circuit that powers down the unit 163356 when the battery is low **Connector Crimp Tool Kit.** Includes one set of 75 Ω ClickLoc inserts and 2 channels, so that you can connector installation instructions. display an orbit for XY probe Supplied with carrying case. configurations. 330951-01 990/991 Test Adapter Accessories 123266-01 284726 Coaxial Cable Kit. Includes 4 cables with length of 1.5 metres (5 feet) each. 02211505 Single coaxial cable with length of 1.5 metres (5 feet). 990/991 Test Adapter Spare Parts 01810700 Battery (9 volt alkaline). 02270056 Ac adapter. Has universal ac input to 9 volts dc output. Input is 108 to 132 Vac with 120 Vac nominal, or 207 to 253 Vac with 240 Vac nominal. 02198937 Power cord (for North American ac power outlet). 123133-01 User Guide. **Probe and Transmitter Accessories** 02173006

> Bulk Cable (specify length in feet). 1.0 mm² (18 AWG), 2-conductor. twisted, shielded cable used for the 4 to 20 mA loop. Also used for the PROX OUT signal on the 991 Transmitter's

terminal strip.

991 Mounting Screws (spares). Contains 4 screws. **DIN rail mounting kit.** Installed on the 990 Transmitter to allow mounting on 35 mm DIN rail.